

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave.St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-023849**Date Inspected:** 20-May-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Corporation, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Mr. Mai Quin Li**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Traveler Rails & Handrail**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Delbert Humphrey was present during the times noted above for observations relative to the work being performed at ZPMC.

OBG Bay # 16

WELDING

This QA Inspector observed the following work in progress:

FCAW welding # 8 fillet weld, Lifting Point Assembly A3N, OBG Deck Bracket , Lift 13. Welder is identified as 053753. ZPMC Quality Control (QC) is identified as Mr. Mai Quin Li. The welding variables recorded by QC appeared to comply with WPS-B-T2132-ESAB (2F).

SMAW welding # 8 fillet weld, Lifting Point Assembly B3, OBG Deck Bracket , Lift 13. Welder is identified as 201861. ZPMC Quality Control (QC) is identified as Mr. Mai Quin Li. The welding variables recorded by QC appeared to comply with WPS-B-T-2112.

SMAW welding # 6 fillet weld, P45 (25 x25 bar) to P19 Pipe (PX36), located on BKR-FS2-2, OBG Bike Path Handrail components. Welder is identified as 205770. ZPMC Quality Control (QC) is identified as Mr. Mai Quin Li. The welding variables recorded by QC appeared to comply with WPS-B-T-2112.

SMAW welding # 6 fillet weld, P45 (25 x25 bar) to P19 Pipe (PX36), located on BKR-FS2-2, OBG Bike Path Handrail components. Welder is identified as 201905. ZPMC Quality Control (QC) is identified as Mr. Mai Quin Li. The welding variables recorded by QC appeared to comply with WPS-B-T-2112.

---

## WELDING INSPECTION REPORT

( Continued Page 2 of 4 )

---

OBG Bay # 14

### WELDING

This QA Inspector observed the following work in progress:

SMAW welding of weld identified as TR3004-TR2-001-008, located on Traveler Rail, TR3021-TR2. Welder is identified as 200569. ZPMC Quality Control (QC) is identified as Mr. Gou Qui Zing. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G/2F-Fcm-Repair-1 & BWR-21511.

SMAW welding of weld identified as TR3004-TR2-001-008, located on Traveler Rail, TR3021-TR2. Welder is identified as 067752. ZPMC Quality Control (QC) is identified as Mr. Gou Qui Zing. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G/2F-Fcm-Repair-1 & BWR-21511.

SMAW welding of weld identified as TR3004-TR2-001-008, located on Traveler Rail, TR3021-TR2. Welder is identified as 046704. ZPMC Quality Control (QC) is identified as Mr. Gou Qui Zing. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G/2F-Fcm-Repair-1 & BWR-21511.

SMAW welding of weld identified as TR3004-TR2-001-008, located on Traveler Rail, TR3021-TR2. Welder is identified as 067752. ZPMC Quality Control (QC) is identified as Mr. Gou Qui Zing. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G/2F-Fcm-Repair-1 & BWR-20755.

SMAW welding of weld identified as TR3004-TR2-001-008, located on Traveler Rail, TR3021-TR2. Welder is identified as 045268. ZPMC Quality Control (QC) is identified as Mr. Gou Qui Zing. The welding variables recorded by QC appeared to comply with WPS-345-SMAW-2G/2F-Fcm-Repair-1 & BWR-20755.

OBG Bay # 13

### WELDING

This QA observed the following components in this bay, OBG, Steel Barriers. This QA observed no work being performed on the above mentioned components during the time QA was present.

OBG Bay # 28

### WELDING

This QA observed the following components in this bay, OBG, Mock-Up Service Hand Rails. This QA observed no work being performed on the above mentioned components during the time QA was present.

Bay 16


This QA noted and took photos the following components that had been returned from paint yard and was damage from poor handling of fork lift on 5-19-11, OBG, Bike Path Hand Rails. This QA informed ABF QC Liu Tao of the damage that had been cause by fork lift.

BKR-FS-2-039, PP91-93, BKR-FS-2-042, PP97-99, BKR-FS-2-027, PP65-67, BKR-FS-2-031, PP73-75, BKR-FS-2-045, PP103-105, BKR-FS-2-035, PP83-85, BKR-FS-2-037, PP87-89, BKR-FS-2-029, PP69-71, BKR-FS-2-026, PP67-69, BKR-FS-2-022, PP5-57.

# WELDING INSPECTION REPORT

( Continued Page 3 of 4 )

Unless otherwise noted, all work observed on this date appeared to be in general compliance with the applicable contract documents.

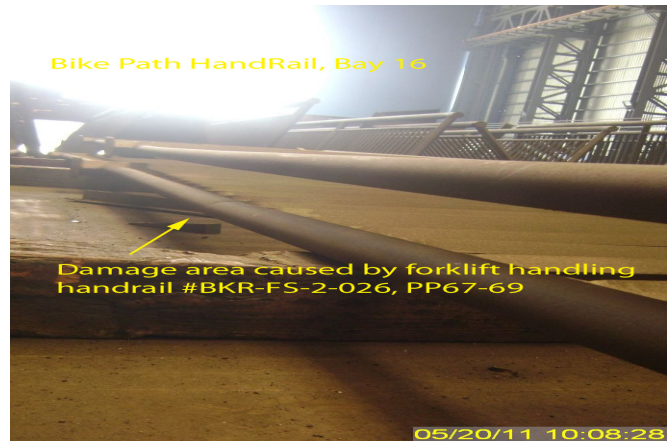

## Summary of Conversations:

No relevant conversations were reported on this date.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or

---

## WELDING INSPECTION REPORT

( Continued Page 4 of 4 )

---

remedial efforts please contact Eric Tsang, 15000422372, who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Humphrey, Delbert	Quality Assurance Inspector
<b>Reviewed By:</b>	Hall, Steven	QA Reviewer

---